

## Description

The 20A20 PWM servo drive is designed to drive brush type DC motors at a high switching frequency. A single red/green LED indicates operating status. The drive is fully protected against over-voltage, under voltage, over-current, over-heating and short-circuits across motor, ground and power leads. Furthermore, the drive can interface with digital controllers or be used stand-alone and requires only a single unregulated DC power supply. Loop gain, current limit, input gain and offset can be adjusted using 14turn potentiometers. The offset adjusting potentiometer can also be used as an on-board input signal for testing purposes.

See Part Numbering Information on last page of datasheet for additional ordering options.

# Power RangePeak Current20 AContinuous Current10 ASupply Voltage40 - 190 VDC



#### Features

- Four Quadrant Regenerative Operation
- DIP Switch Selectable Modes
- Adjustable Current Limits
- High Switching Frequency
- Differential Input Command
- Digital Fault Output Monitor

## On-Board Test Potentiometer

- Offset Adjustment Potentiometer
- Adjustable Input Gain
- Drive Status LED
- Current Monitor Output
- Directional Inhibit Inputs for Limit Switches

## MODES OF OPERATION

- Current
- Voltage
- IR Compensation
- Velocity

## COMMAND SOURCE

±10 V Analog

## FEEDBACK SUPPORTED


Tachometer (±60 VDC)

## **COMPLIANCES & AGENCY APPROVALS**

- UL
- cUL
- CE Class A (LVD)
- CE Class A (EMC)
  DallC
- RoHS



# BLOCK DIAGRAM

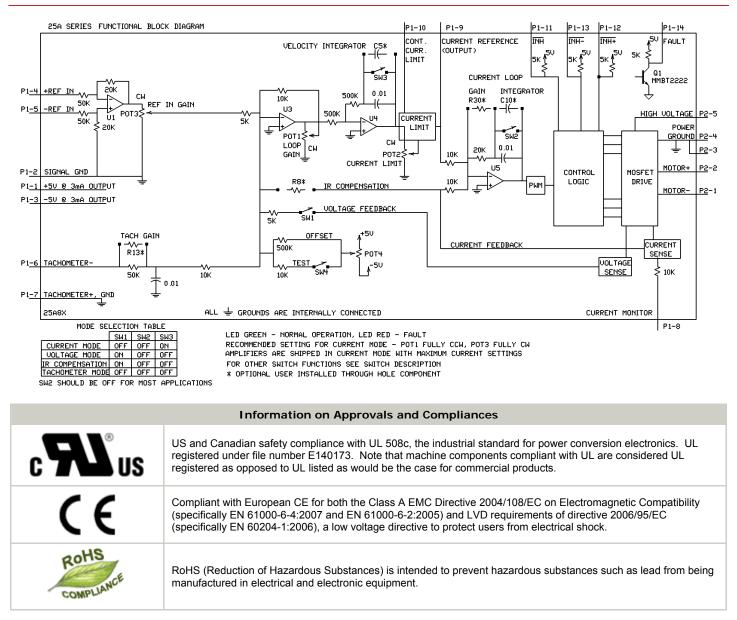



# SPECIFICATIONS

	Power S	Specifications		
Description	Units	Value		
DC Supply Voltage Range	VDC	40 - 190		
DC Bus Over Voltage Limit	VDC	195		
Maximum Peak Output Current <sup>1</sup>	A	20		
Maximum Continuous Output Current	A	10		
Maximum Continuous Output Power	W	1805		
Maximum Power Dissipation at Continuous Current	W	95		
Minimum Load Inductance (Line-To-Line) <sup>2</sup>	μΗ	250		
Low Voltage Supply Outputs	-	±5 VDC (3 mA)		
Switching Frequency	kHz	22		
	Control	Specifications		
Description	Units	Value		
Command Sources	-	±10 V Analog		
Feedback Supported	-	Tachometer (±60 VDC)		
Commutation Methods	-	Brush Type		
Modes of Operation	-	Current, IR Compensation, Velocity, Voltage		
Motors Supported	-	Single Phase (Brushed, Voice Coil, Inductive Load)		
Hardware Protection		Over Current, Over Temperature, Over Voltage, Short Circuit (Phase-Phase & Phase-Ground)		
Primary I/O Logic Level		5V TTL		
	Mechanica	al Specifications		
Description	Units	Value		
Agency Approvals	-	CE Class A (EMC), CE Class A (LVD), cUL, RoHS, UL		
Size (H x W x D)	mm (in)	129.3 x 75.8 x 25.1 (5.1 x 3 x 1)		
Weight	g (oz)	280 (9.9)		
Heatsink (Base) Temperature Range <sup>3</sup>	°C (°F)	0 - 65 (32 - 149)		
Storage Temperature Range	°C (°F)	-40 - 85 (-40 - 185)		
Form Factor	-	Panel Mount		
P1 Connector	-	16-pin, 2.54 mm spaced, friction lock header		
P2 Connector	-	5-port, 5.08 mm spaced, screw terminal		

Notes

Maximum duration of peak current is ~2 seconds. Peak RMS value must not exceed continuous current rating of the drive. Lower inductance is acceptable for bus voltages well below maximum. Use external inductance to meet requirements. Additional cooling and/or heatsink may be required to achieve rated performance. 1.

2. 3.



# **PIN FUNCTIONS**

P1 - Signal Connector				
Pin Name		Description / Notes		
1	+5V 3mA OUT			
2	SIGNAL GND	±5 V @ 3 mA low power supply for customer use. Short circuit protected. Reference ground common with signal ground.	GND	
3	-5V 3mA OUT			
4	+REF IN	Differential Reference Input (±10 V Operating Range, ±15 V Maximum Input)	I	
5	-REF IN	Diferential Reference input (±10 v Operating Range, ±15 v Maximum input)		
6	-TACH IN	Negative Tachometer Input (Maximum ±60 V). Use signal ground for positive input.	I	
7	+TACH / GND	Positive Tachometer Input and Signal Ground	GND	
8	CURRENT MONITOR	Current Monitor. Analog output signal proportional to the actual current output. Scaling is 4.4 A/V. Measure relative to signal ground.	0	
9	CURR REF OUT	Measures the command signal to the internal current-loop. This pin has a maximum output of ±7.25 V when the drive outputs maximum peak current. Measure relative to signal ground.	0	
10	CONT CURRENT LIMIT	Can be used to reduce the factory-preset maximum continuous current limit without affecting the peak current limit by attaching an external current limiting resistor between this pin and signal ground. See pin details for resistor values.	I	
11	INHIBIT IN	TTL level (+5 V) inhibit/enable input. Leave open to enable drive. Pull to ground to inhibit drive. Inhibit turns off all power devices.	I	
12	+INHIBIT IN	Positive Direction Inhibit (Does Not Cause A Fault Condition)	I	
13	-INHIBIT IN	Negative Direction Inhibit (Does Not Cause A Fault Condition)	I	
14	FAULT OUT	TTL level (+5 V) output becomes high when power devices are disabled due to at least one of the following conditions: inhibit, output short circuit, over voltage, over temperature, power-up reset.	ο	
15	NC	Not Connected (Reserved)	-	
16	NC	Not Connected (Reserved)	-	

P2 - Power Connector				
Pin	Name	Description / Notes	1/0	
1	-MOT	Negative Motor Output	0	
2	+MOT	Positive Motor Output	0	
3	POWER GND	Power Ground (Common With Signal Ground)	PGND	
4	POWER GND		PGND	
5	HIGH VOLTAGE	DC Power Input	I	

## **Pin Details**

#### CONT CURRENT LIMIT (P1-10)

This pin can be used to reduce the continuous current limit without affecting the peak current limit by connecting an external current limiting resistor between this pin and signal ground. See table below.

Current Limit Resistor	15 kΩ	6.6 kΩ	3.4 kΩ	2.1 kΩ	1.2 kΩ	810Ω	500 Ω	250 Ω	0 kΩ
Continuous Current Limit	90%	80%	70%	60%	50%	40%	30%	20%	10%

Note: These values are secondary to the continuous/peak ratio set by the DIP switches.



# HARDWARE SETTINGS

## **Switch Functions**

Switch	Description	Setting		
Switch	Description	On	Off	
1	Voltage feedback. Mode dependent (see mode selection table below).	On	Off	
2	Current loop integral gain. Activates or deactivates integration. OFF by default.	Inactive	Active	
3	Outer loop integration. Activates or deactivates integration. ON, by default, for current mode and OFF for other modes.	Inactive	Active	
4	Test/Offset. Switches the function of the Test/Offset pot between an on-board command input for testing or a command offset adjustment. OFF by default.	Test	Offset	

#### Mode Selection Table

	SW1	SW3
CURRENT	OFF	ON
VOLTAGE	ON	OFF
IR COMPENSATION	ON	OFF
TACHOMETER VELOCITY	OFF	OFF

#### **Potentiometer Functions**

Potentiometer	Description	Turning CW		
1  Loop gain adjustment for voltage/velocity modes. Turn this pot fully CCW in current mode.    2  Current limit. It adjusts both continuous and peak current limit while maintaining their ratio.		Increases gain		
		Increases limit		
3	Reference gain. Adjusts the ratio between input signal and output variables (voltage, current, or velocity).	Increases gain		
4	Offset / Test. Used to adjust any imbalance in the input signal or in the amplifier. Can also be used as an on-board signal source for testing purposes.	Adjusts offset in negative direction		
Note: Potentiometers are approximately linear and have 12 active turns with 1 inactive turn on each end.				



## Through-hole Components<sup>†</sup>

Location	Description
C10*	Current Loop Integrator. Through-hole capacitor that can be added for more precise current loop tuning. See section below on Tuning with Through-hole components for more details.
C5*	Velocity Loop Integrator. Through-hole capacitor that can be added for more precise velocity loop tuning. See section below on Tuning with Through-hole components for more details.
R13*	Tachometer Input Scaling. Through-hole resistor that can be added to change the gain of the tachometer input. See section below on Tachometer Gain for more details.
R30*	Current Loop Proportional Gain. Through-hole resistor that can be added for more precise current loop tuning. See section below on Tuning with Through-hole components for more details.
R8*	IR Compensation Scaling. Through-hole resistor that must be added to configure the amplifier for IR Compensation mode. See section below on IR Compensation Notes for more details.

#### Tachometer Gain

Some applications may require an increase in the gain of the tachometer input signal. This occurrence will be most common in designs where the tachometer input has a low voltage to RPM scaling ratio. The drive offers a through-hole location listed in the above table where a resistor can be added to increase the tachometer gain. Use the drive's block diagram to determine an appropriate resistor value.

#### Tuning With Through-hole Components

In general, the drive will not need to be further tuned with through-hole components. However, for applications requiring more precise tuning than what is offered by the potentiometers and dipswitches, the drive can be manually modified with through-hole resistors and capacitors as denoted in the above table. By default, the through-hole locations are not populated when the drive is shipped. Before attempting to add through-hole components to the board, consult the section on loop tuning in the installation notes on the manufacturer's website. Some general rules of thumb to follow when adding through-hole components are:

A larger resistor value will increase the proportional gain, and therefore create a faster response time.

• A larger capacitor value will increase the integration time, and therefore create a slower response time. Proper tuning using the through-hole components will require careful observation of the loop response on a digital oscilloscope to find the optimal through-hole component values for the specific application.


#### IR Compensation Notes

For applications that will use IR Compensation mode, a resistor must be added to the location named in the table above. The combination of the added resistor and correct dipswitch settings will configure the amplifier for IR Compensation mode. While in IR Compensation mode, the amplifier will adjust the duty cycle to compensate for changes in the output current. Consult the amplifier's functional block diagram and the manufacturer's website for more information.

#### <sup>†</sup>Note: Damage done to the drive while performing these modifications will void the warranty.




## MECHANICAL INFORMATION

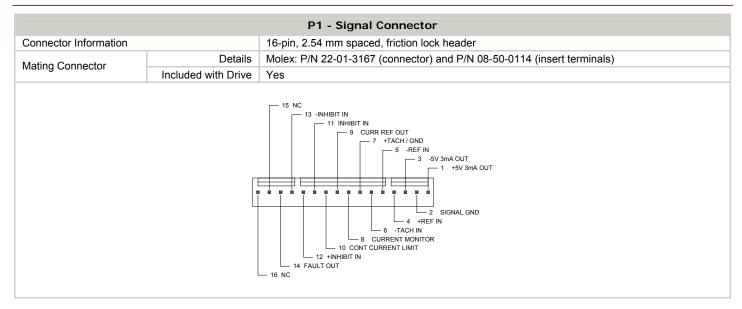

P2 - Power Connector		
Connector Information		5-port, 5.08 mm spaced, screw terminal
Mating Connector	Details	Not applicable
Mating Connector	Included with Drive	Not applicable
		J J J J J J J J J J J J J J J J J J J




# MOUNTING DIMENSIONS

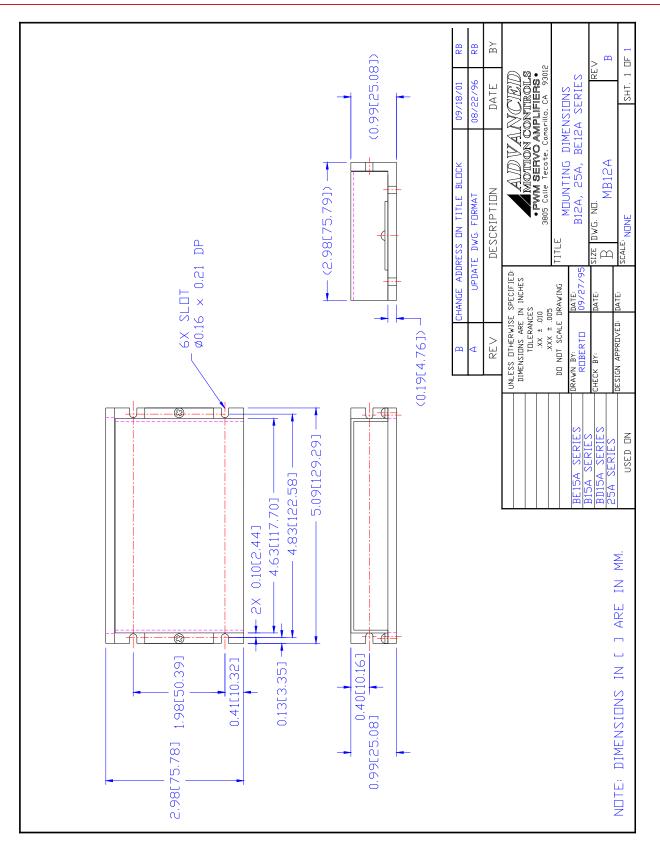



# PART NUMBERING INFORMATION

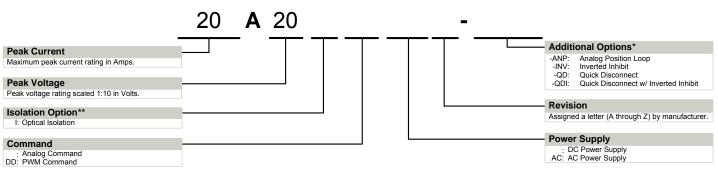

\* Options available for orders with sufficient volume. Contact ADVANCED Motion Controls for more information.

\*\* Isolation comes standard on all AC supply drives and most DC supply drives 200V and above. Consult selection tables of the website or the drive datasheet block diagram to see if isolation is included.

ADVANCED Motion Controls analog series of servo drives are available in many configurations. Note that not all possible part number combinations are offered as standard drives. All models listed in the selection tables of the website are readily available, standard product offerings.


*ADVANCED* Motion Controls also has the capability to promptly develop and deliver specified products for OEMs with volume requests. Our Applications and Engineering Departments will work closely with your design team through all stages of development in order to provide the best servo drive solution for your system. Equipped with on-site manufacturing for quick-turn customs capabilities, *ADVANCED* Motion Controls utilizes our years of engineering and manufacturing expertise to decrease your costs and time-to-market while increasing system quality and reliability.

#### Examples of Modifications and Customized Products

- Integration of Drive into Motor Housing
- Mount OEM PCB onto Drive Without Cables
- Multi-axis Configuration for Compact System
- Custom PCB and Baseplate for Optimized Footprint
- RTV/Epoxy Components for High Vibration
- OEM Specified Connectors for Instant Compatibility
- OEM Specified Silkscreen for Custom Appearance
- Increased Thermal Limits for High Temp. Operation
- ▲ Integrate OEM Circuitry onto Drive PCB
- Custom Control Loop Tuned to Motor Characteristics
- ▲ Custom I/O Interface for System Compatibility
- Preset Switches and Pots to Reduce User Setup
- Optimized Switching Frequency
- Ramped Velocity Command for Smooth Acceleration
- Remove Unused Features to Reduce OEM Cost
- Application Specific Current and Voltage Limits
- Feel free to contact Applications Engineering for further information and details.

#### **Available Accessories**

ADVANCED Motion Controls offers a variety of accessories designed to facilitate drive integration into a servo system. Visit <u>www.a-m-c.com</u> to see which accessories will assist with your application design and implementation.

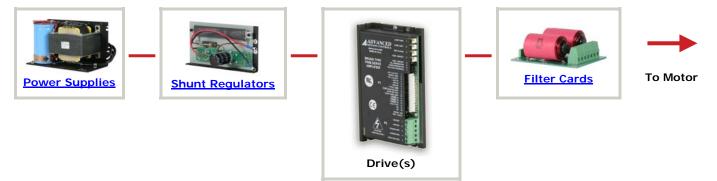

All specifications in this document are subject to change without written notice. Actual product may differ from pictures provided in this document.